

KIT NUMBER	
DBABU3016	


APPLICATION	
Toyota Landcruiser 76, 78, 79 (VDJ) 01/2007 - on	

REF	DESCRIPTION	QTY
1	4000S T3- Slotted Rotor	2
2	Banjo Bolt	2
3	Cooper Gasket	4
4	Brake Hose KIT	1
5	Caliper Assembly	2
6	Caliper Bleed Screw	4
7	Caliper Bracket Connecting Bolt (M12-1.25)	O.E.
8	Washer (M12-TH3.2mm)	O.E.
9	Brake Pad	1SET
10	Tension Spring	2
11	Retainer Fixed Pin	4
11	Retainer Fixed Bolt	4
12	Retainer Fixed Nut	2
13	Caliper Lock Pin	4


TIGHTENING TORQUES	
Ref#	Torque (N-M)
NO. 2	25~27
NO. 6	7
NO. 7	O.E.STD.
13,14	17

BRAKE ROTOR WEAR	
NEW	MIN
Thickness 32mm	30mm

BRAKE PAD WEAR	
NEW	MIN
Thickness 16mm	8mm

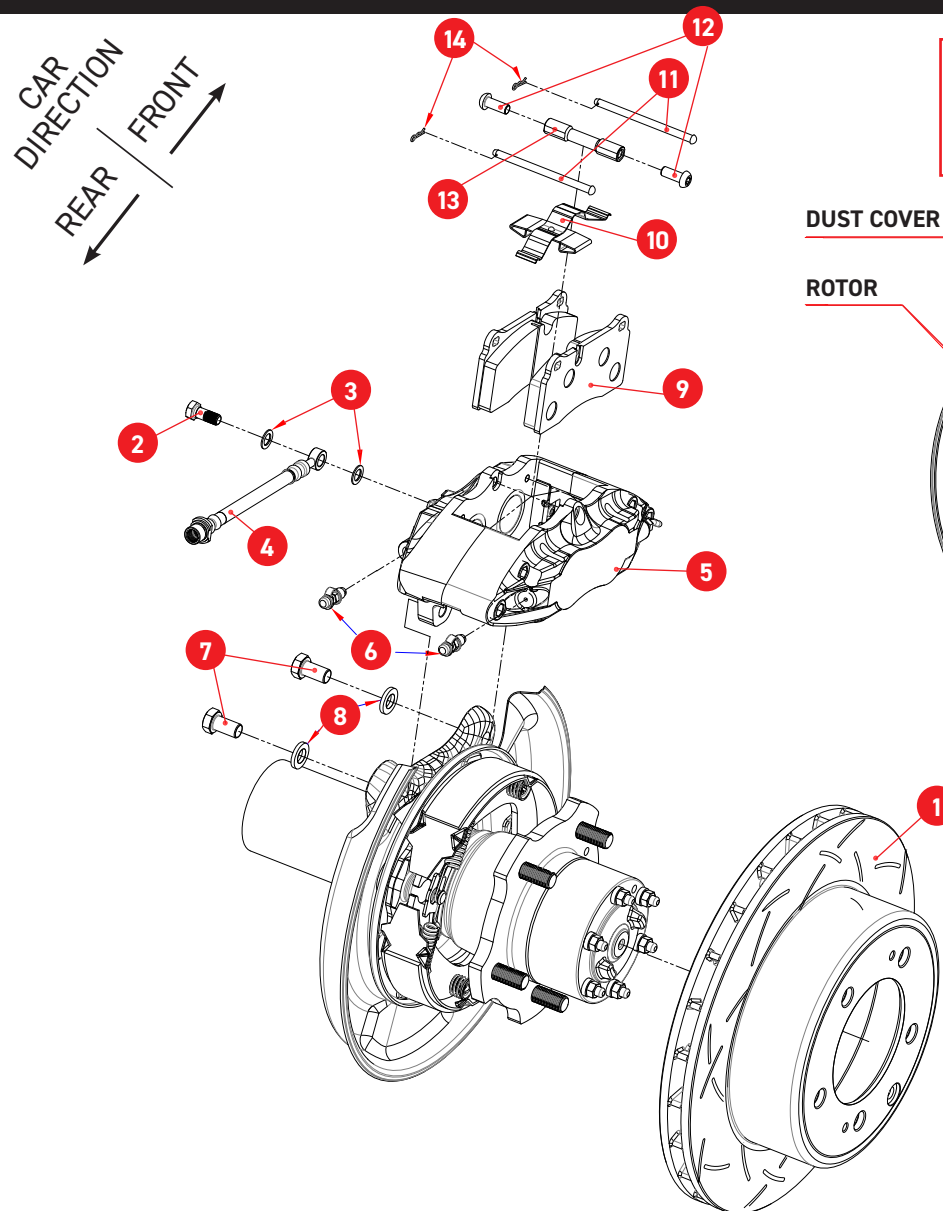


When installing the upgrade kit, please remove the dust cover to avoid interference in the area where the caliper is installed.

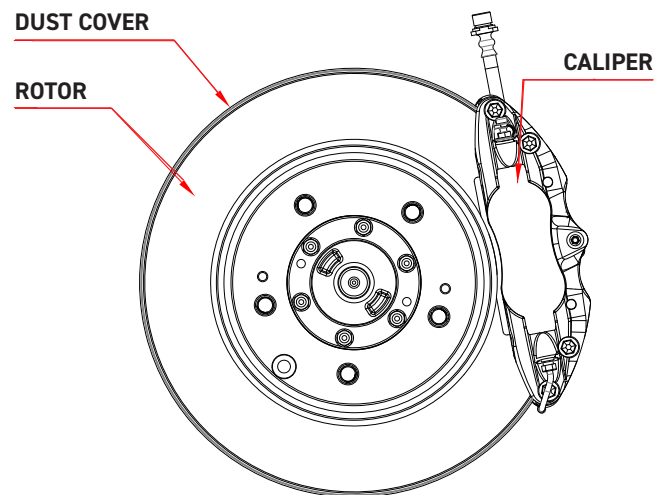

INSTALLATION DIRECTION (LEFT HAND SIDE)

It's recommended to use *LOCITE (NO.271) on bolts to fasten bracket and knuckle. *LOCITE (NO.271) = Removable/High Strength Thread-locker


275mm

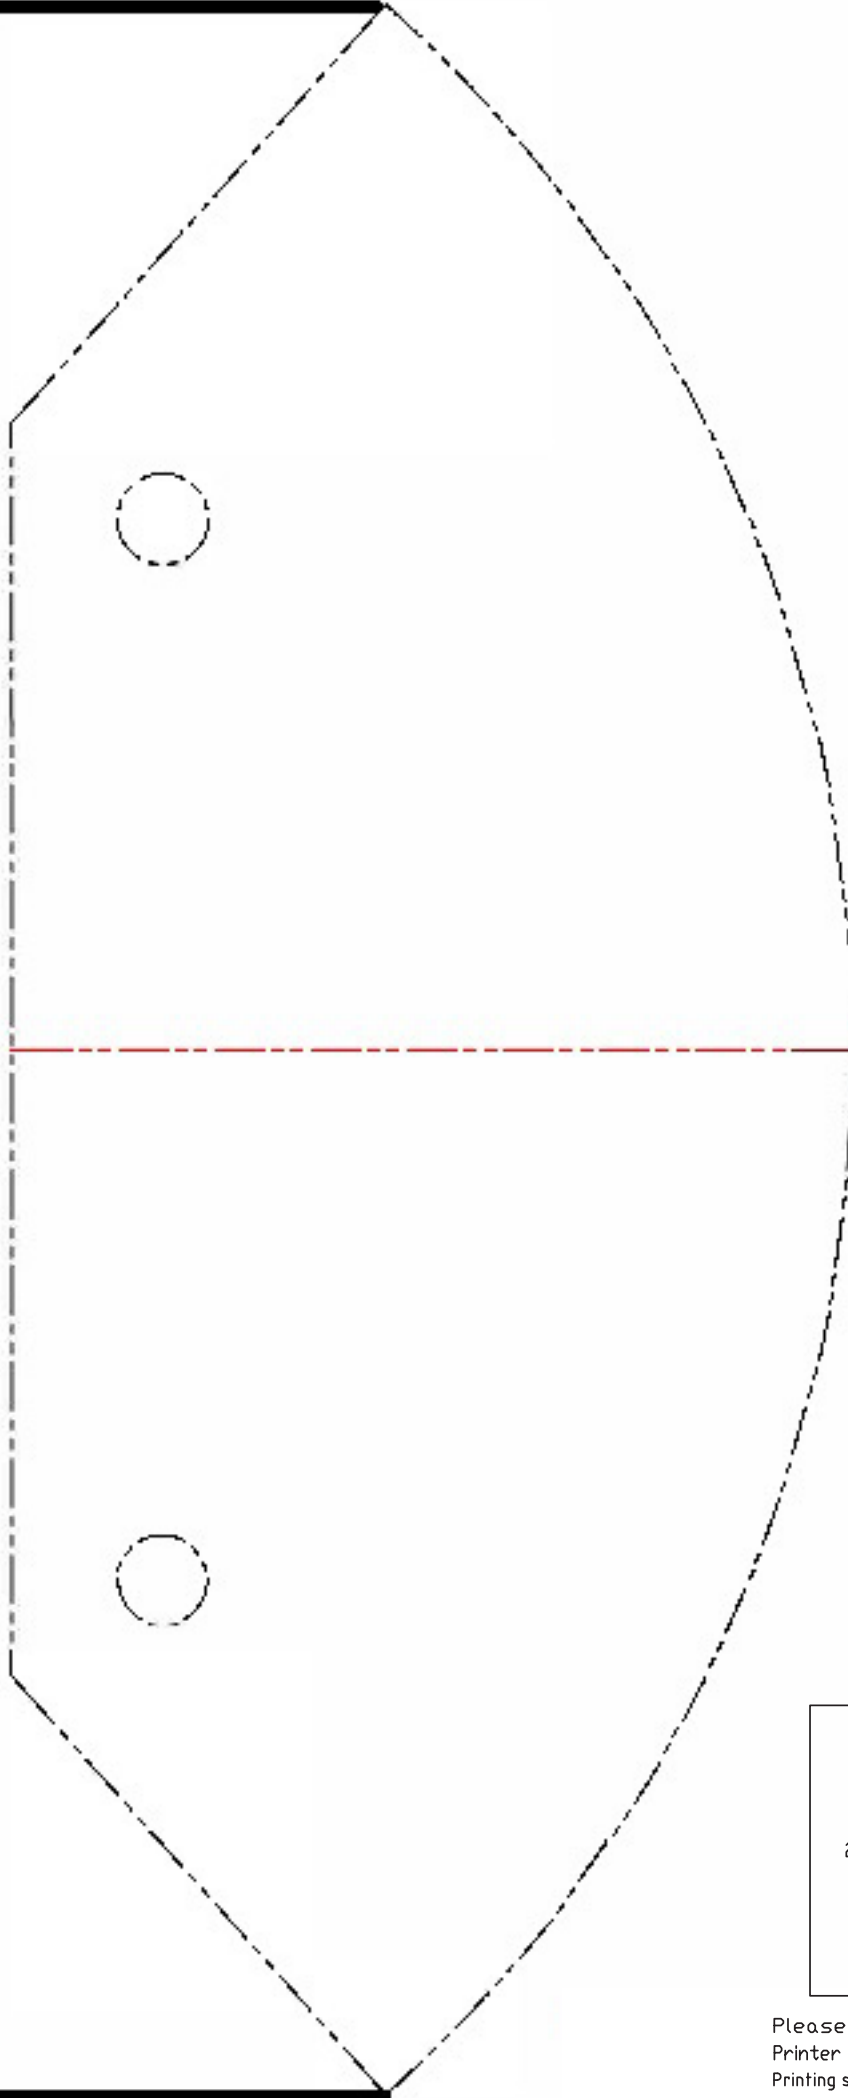

CHECK WHEEL OFFSET WITH THE TEMPLATE

Application: Toyota Landcruiser 76, 78, 79 (VDJ) 01/2007 - on

Specifications: Caliper: 4 Pistons/Rotor size: Ø345mm / Wheel size: 17" ROTOR No: DBA4C21S

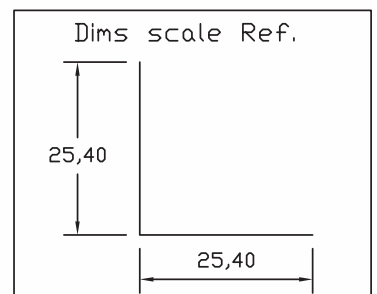

Please Check Scale When Printed
Printer Page Scaling select [none]
Printing scale = 1 : 1